



WV-X8571N Release Note

- 1. Release version: 2.02
- 2. Release Note Reference Number: X8571N\_008

VER (ActiveX VER) Release Date	Priority Rank Level				Contents
	A	B	C	U	
Ver1.03 <del>(4.60.03)</del> (4.60.01) May, '21			x		<p>Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing</p> <p>Issue (Phenomenon): Unable to set "8 mega pixel [16:9](12.5fps mode)" in [Image capture mode] from a particular VMS.</p> <p>Occurrence condition: -</p> <p>Correspondence: Fixed.</p>
Ver1.50 (4.60.01) July, '21	C			x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Added the following actions for SD memory card error: - Displays the following alert when a bit rate higher than "2048kbp" is selected in [Max bit rate (per client)*]: "Since the value of "Max bit rate (per client)" of H.265/H.264 recording stream set for "Recording format" is larger than "2048kbps", there is a possibility an abnormality will occur in continuity of recorded video. It is recommended to set it to "2048kbps" or less." - Records SD memory card logs on the [Status] tab in the [Maintenance] page, in the case of loss of recording or abnormal response from an SD memory card - Sends Panasonic alarm protocol "Diag." to the destination servers designated in the [Notification] tab of the [Alarm] page, in the case of abnormal response from an SD memory card</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Enhanced security.</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Improved the response to the CGI command "/cgi-bin/get_io2" by adding VMD ratio in percentage.</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Changed the default setting of [Network Settings] in [Setup]-&gt; [Network] page-&gt; [Network] tab, from "Auto(Advanced)" to "DHCP".</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Added the On/Off setting for the Secure Real-time Transport Protocol (SRTP) function to the [Advanced] tab in [Setup]-&gt; [Network] page.</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Improved the [HTTP alarm notification] function as follows: 1. Supports Digest authentication - The camera performs either "Digest" or "Basic" authentication according to the response from the HTTP server when initially accessed without ID and password. 2. Adds an error log for the failure in HTTP server user authentication - Displays "&lt;HTTP alarm notification&gt; authentication error" in the system log when the authentication fails. 3. Supports HTTPS Communication - Entering "https://" in [Address] enables HTTPS communication.</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Added the On/Off setting for ONVIF® to the [Network] tab in [Setup]-&gt; [Network] page. (Default : On)</p>
				x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Increased the maximum password length from 32 to 128 characters for "Authentication" in the [Network] page-&gt; [Advanced] tab-&gt; "SMTP(E-mail)".</p>
			x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Improved the visibility of the [Setup] window by adjusting the color of blue letters.</p>	
			x	<p>Issue (Phenomenon): -</p> <p>Occurrence condition: -</p> <p>Correspondence: Corrected the camera response to the CGI command "cgi-bin/setdata".</p>	

\*: ONVIF is a trademark of Onvif, Inc.

WV-X8571N Release Note

- 1. Release version: 2.02
- 2. Release Note Reference Number: X8571N\_008

VER (ActiveX VER) Release Date	Priority Rank Level				Issue (Phenomenon)	Occurrence condition	Correspondence
	A	B	C	U			
Ver1.50 (4.60.01) July, '21	C			x	Playing back the image from the log list may show a black image on the camera browser. (Occurrence frequency: Rare)	When satisfying both of the following conditions: - Perform the playback after recovering from a temporary power failure that occurred during SD memory card recording - Select the log when the power failure occurred	Fixed.
				x			Corrected the RTSP protocol for transmitting H.265 images using ONVIF®.
				x			Corrected the camera response to the "GetVideoEncoderConfigurationOptions" command of ONVIF Profile S.
Ver1.51 (4.60.01) Sept., '21	U			x	-	-	Supports the following RTSP URLs for image and audio transmission: - "rtsp://<IP address>/MediaInput" - "rtsp://<IP address>/Src/MediaInput"
				x	-	-	Supports the CGI command "/cgi-bin/set_imgmode?img_mode=8m_12_5" for VMS integration.
Ver1.60 (4.60.01) Dec., '21	B			x			Added a CGI command to transmit H.265/H.264 stream without NAL unit. Without NAL: "cgi-bin/setdata?H264NONALFLG=1" With NAL (default): "cgi-bin/setdata?H264NONALFLG=0"
				x	-	-	Supports Message Queueing Telemetry Transport (MQTT) for alarm notification. MQTT setting has been added to the [Advanced] tab on the [Network] page.
				x	-	-	Supports TLS 1.3. TLS setting has been added to the "HTTPS" window on the [Advanced] tab in the [Network] page.
				x			Added the following note under the on/off setting of "Internet mode" on the [Image] tab in the [Image/Audio] page:  "When "On" is selected, streams will be transmitted using the HTTP port. When "Off" is selected, streams will be transmitted using the UDP port."
				x	-	-	Added supported browser information to the camera response to IP Setting Software and the CGI command "getinfo".
				x	-	-	Changed the alarm name from "Panasonic alarm protocol notification" to "TCP alarm notification".
				x	-	-	Added Subject Alternative Name (SAN) to the certificate signing request (CSR) for creating an HTTPS server certificate.
				x	-	-	Added "NTP test" function to the "NTP" window on the [Advanced] tab in the [Network] page.
		x	-	-	Improved the visibility of camera setting screen as follows: - Removed unnecessary titles - Switched the position of "Next" and "Back" button		
			x	Unable to perform multicast transmission. (Occurrence frequency: Rare)	When the camera is started with the following settings: - "DHCP" is selected for "Network Settings" on the [Network] tab of the [Network] page - "Multicast" is selected for [Transmission type]	Fixed.	

\*: ONVIF is a trademark of Onvif, Inc.

WV-X8571N Release Note

- 1. Release version: 2.02
- 2. Release Note Reference Number: X8571N\_008

VER (ActiveX VER) Release Date	Priority Rank Level				Contents					
	Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing				Issue (Phenomenon)	Occurrence condition	Correspondence			
	A	B	C	U						
Ver1.60 (4.60.01) Dec., '21	B				x	-	-	Improved the accuracy of time synchronization with NTP server.		
						x	Unable to configure OSD settings using the ONVIF command "SetOSD() tt:OSDConfiguration Token"	-	Fixed.	
						x	Firmware upgrade may fail. (Occurrence frequency: Rare)	When upgrading the camera(s) connected to WJ-NX100.	Fixed.	
							x	-	-	Adjusted the Mic input volume on Google Chrome, Microsoft Edge, and Firefox to be equivalent to Internet Explorer.
							x	Long press on [Manual zoom adjustment] button or [Brightness adjustment] button incorrectly starts text input mode on the button. (Occurrence frequency: High)	On the setup menu of "/tab" window for tablet device.	Fixed.
								x	-	Changed the default setting of [Overwrite] from "Off" to "On" on the [SD memory card] tab in the [Basic] page.
									x	Modified the French description on the [User. Auth] tab and [Host auth.] tab as below: 1. Camera control - From "Com. cam. Vid" to "Contrôle camera" 2. Live only - From "En dir.sl" to "Flux direct"
Ver2.00 (4.60.30) Apr., '22	U							Under the following conditions: - [Stream encoding format] is set to H.265 for Stream 1 - [Stream encoding format] is set to H.264 or H.265 for Stream 2	Fixed.	
							x	Unable to change the [Image capture size] setting of Stream 1 or Stream 2 from Genetec Security Center. (Occurrence frequency: High)	Fixed.	
								x	Changed company name from "Panasonic i-PRO Sensing Solutions Co., Ltd." to "i-PRO Co., Ltd."	
									x	Updated SNMP extended MIB: Changed the extended Object ID(OID) from Panasonic(258) to i-PRO(57501). Note: - This change applies only to the products manufactured in April, 2022* or later, and is not applied by firmware upgrade. *Serial number: VDxxxxxx - MIB file and manual are available at the following link: <a href="https://i-pro.com/global/en/surveillance/database/i-pro-device-integration/snmp-mib">https://i-pro.com/global/en/surveillance/database/i-pro-device-integration/snmp-mib</a>

\*: ONVIF is a trademark of Onvif, Inc.

This document describes software package upgrade for WV-X8571N.  
 1. Release version: 2.02  
 2. Release Note Reference Number: X8571N\_008

WV-X8571N Release Note

VER (ActiveX VER) Release Date	Priority Rank Level				Contents		
	A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
Ver2.01 (4.60.30) Aug., '22				x	-	-	Added the note "Use the latest edition of the software product." to the [Upgrade] tab in the [Maintenance] page.
				x	-	-	Added Link Layer Discovery Protocol (LLDP) setting tab to the [Advanced] tab on the [Network] page.
				x	-	-	Enhanced security.
Ver2.02 (4.60.30) Sept., '22				x	-	-	Changed the company name in the GlobalSign digital certificate installed on the camera to "i-PRO Co., Ltd."

\*: ONVIF is a trademark of Onvif, Inc.